

CLARKDIETRICH BUILDING SYSTEMS, LLC ACOUSTICAL PERFORMANCE TEST REPORT

SCOPE OF WORK

ASTM E90 SOUND TRANSMISSION LOSS TESTING ON A UL-U465, WALL SYSTEM

REPORT NUMBER

L3173.04-113-11-R0

TEST DATE

10/13/20

ISSUE DATE

01/05/21


PAGES

11

DOCUMENT CONTROL NUMBER

RT-R-AMER-Test-2758 (01/24/19)

© 2017 INTERTEK

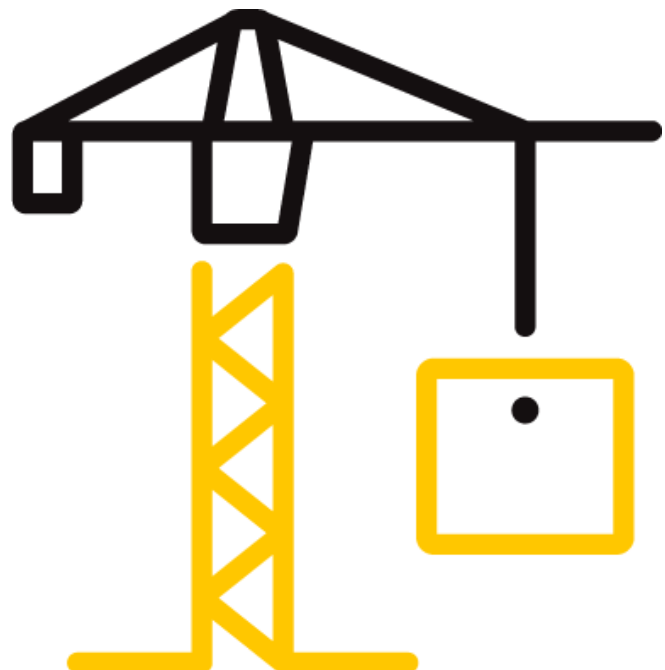

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

REPORT ISSUED TO

CLARKDIETRICH BUILDING SYSTEMS, LLC

9050 Centre Pointe Drive
West Chester, Ohio 45069

SECTION 1

SCOPE

Intertek Building & Construction (B&C) was contracted by ClarkDietrich Building Systems, LLC to conduct a sound transmission loss test. Results obtained are tested values and were secured by using the designated test methods. The complete test data is included herein. The client provided the test specimen. All measurements were conducted in the HT test chambers at Intertek B&C located in York, Pennsylvania.

This report does not constitute certification of this product nor an opinion or endorsement by this laboratory. Intertek B&C will service this report for the entire test record retention period. The test record retention period ends four years after the test date. Test records, such as detailed drawings, datasheets, representative samples of test specimens, or other pertinent project documentation, will be retained for the entire test record retention period.

For INTERTEK B&C:

COMPLETED BY:	Zachary P. Golden	REVIEWED BY:	Kurt A. Golden
TITLE:	Technician Team Leader Acoustical Testing	TITLE:	Project Lead Acoustical Testing
SIGNATURE:		SIGNATURE:	
DATE:	01/05/21	DATE:	01/05/21

ZPG:jmcs

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample(s) tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.



TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

SECTION 2

SUMMARY OF TEST RESULTS

SERIES/MODEL	UL-U465
TYPE	Wall System
DATA FILE NO.	L3173.01C2
INSULATION TYPE	Mineral Wool
STC	53
OITC	36

SECTION 3

TEST METHODS

The specimens were evaluated in accordance with the following:

ASTM E90-09 (2016), *Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements*

ASTM E413-16, *Classification for Rating Sound Insulation*

ASTM E1332-16, *Standard Classification for Rating Outdoor-Indoor Sound Attenuation*

ASTM E2235-04 (2020), *Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods*

SECTION 4

SPECIMEN INSTALLATION

The specimen was constructed in the laboratory. A sound transmission loss test was initially performed on a filler wall. The 96" wide by 96" high specimen plug was removed from the filler wall assembly. The specimen was placed on an isolation pad in the test opening. Duct seal was used to seal the perimeter of the specimen to the test opening on both sides. The interior side of the specimen, when installed, was approximately 1/4" from being flush with the receive room side of the filler wall. A stethoscope was used to check for any abnormal air leaks around the test specimen prior to testing.

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

**SECTION 5
EQUIPMENT**

The equipment listed below meets the requirements of the test methods stated in Section 3 of this report.

INSTRUMENT	MANUFACTURER	MODEL	DESCRIPTION	ASSET #	CAL DATE
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	63763-3*	04/20
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	65125*	05/20
Data Acquisition Card	National Instruments	PXI-4462	Data Acquisition Card	65126*	05/20
Source Room Microphone	PCB Piezotronics	378C20	Microphone and Preamplifier	65968	01/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64903	09/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	65103	03/20
Source Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64905	03/20
Source Room Microphone	PCB piezotronics	378B20	Microphone and Preamplifier	64906	03/20
Receive Room Microphone	PBC Piezotronics	378B20	Microphone and Preamplifier	64907	01/20
Receive Room Microphone	PCB Piezotronics	378C20	Microphone and Preamplifier	64908	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64909	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	64910	01/20
Receive Room Microphone	PCB Piezotronics	378B20	Microphone and Preamplifier	65586	08/20
Receive Room Environmental Indicator	Comet	T7510	Receive Room	64915	01/20
Source Room Environmental Indicator	Comet	T7510	Source Room	64914	02/20
Microphone Calibrator	Norsonic	1251	Acoustical Calibrator	Y002919	04/20

*- Note: The calibration frequency for this equipment is every two years per the manufacturer's recommendation.

TEST CHAMBER

	VOLUME	DESCRIPTION
RECEIVE ROOM	234 m ³	Rotating vane and stationary diffusers Temperature and humidity controlled Isolation pads under the floor
SOURCE ROOM	207 m ³	Stationary diffusers only Temperature and humidity controlled

	MAXIMUM SIZE	DESCRIPTION
TL TEST OPENING	4.27 m wide by 3.05 m high	Vibration break between source and receive rooms

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

SECTION 6

LIST OF OFFICIAL OBSERVERS

NAME	COMPANY
Adam Shoemaker	ClarkDietrich Building Systems, LLC
Zachary Golden	Intertek B&C
Kurt Golden	Intertek B&C

SECTION 7

TEST PROCEDURE

The sensitivity of the microphones was checked before measurements were conducted.

The transmission loss values were obtained for a single direction of measurement.

Two background noise sound pressure level and five sound absorption measurements were conducted at each of five microphone positions.

Two sound pressure level measurements were made simultaneously in receive and source rooms at each of five microphone positions.

The air temperature and relative humidity conditions were monitored and recorded during all measurements.

Data for flanking limit tests, repeatability measurements, and reference specimen tests are available upon request.

Intertek B&C will store samples of test specimens for four years.

SECTION 8

ACOUSTICAL TEST CALCULATIONS

Transmission loss (TL) at each 1/3 octave frequency is the average source room sound pressure level minus the average receive room sound pressure level, plus, 10 times the log of the specimen area divided by the sound absorption of the receive room with the sample in place.

STC Rating

To obtain the Sound Transmission Class (STC), read the TL of the contour curve at 500 Hz. The sum of the deficiencies below the contour curve must not exceed 32. The maximum deficiency at any one frequency must not exceed 8.

OITC Rating

The Outdoor-Indoor Transmission Class (OITC) is calculated by subtracting the logarithmic summation of the TL values from the logarithmic summation of the A-weighted transportation noise spectrum stated in ASTM E1332.

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

SECTION 9

SPECIMEN DESCRIPTION

SOURCE SIDE GYPSUM BOARD	One Layer 5/8" Type X
STUDS	3-5/8" ProSTUD 20 (18 mil), 20-Gauge Equivalent Steel, 24" Centers
TRACK	3-5/8" ProSTUD 20 (18 mil), 20-Gauge Equivalent Steel,
INSULATION	Mineral wool
STUD TREATMENT	ClarkDietrich Sound Clip (CDSC)
FURRING CHANNELS	25 Gauge (18 mil)
RECEIVE SIDE GYPSUM BOARD	One Layer 5/8" Type X

MATERIAL	ACTUAL DIMENSIONS (inches)	ACTUAL THICKNESS (inches)	MANUFACTURER AND SERIES	QUANTITY	AVERAGE WEIGHT
SOURCE SIDE GYPSUM BOARD	48 by 96	0.625	5/8" USG Sheetrock® Brand Firecode® X Panels (UL Type SCX)	2 sheets	2.20 lbs/ft ²
	<i>Note: Screws spaced on 8" centers on edge and 12" centers in field. Perimeter and joints sealed with acoustical sealant and foil tape. Screw heads sealed with foil tape.</i>				
STUD	1-1/4 by 96	3-5/8	ClarkDietrich ProSTUD® 20 (18 mil), Steel	5 pieces	0.42 lbs/linear ft
	<i>Note: Spaced on 24" centers. Screwed to top and bottom plates.</i>				
INSULATION	24 by 96	3	Owens Corning Thermafiber® SAFB	4 pieces	0.54 lbs/ft ²
	<i>Note: Fiction fit.</i>				
STUD TREATMENT	3 by 1-1/4	0.04	ClarkDietrich Sound Clip™ (CDSC)	15 pieces	0.13 lbs each
	<i>Note: Used to attach furring channels. Clips spaced on 48" centers.</i>				
FURRING CHANNEL	2-23/32 by 96	0.002	7/8" Steel, 25 gauge (18 mil)	5 pieces	0.24 lbs/linear ft
	<i>Note: Spaced on 24" centers perpendicular to studs, friction fit into clips.</i>				
RECEIVE SIDE GYPSUM BOARD	48 by 96	0.633	5/8" USG Sheetrock® Brand Firecode® X Panels (UL Type SCX)	2 sheets	2.20 lbs/ft ²
	<i>Note: Screws spaced on 12" centers. Perimeter and joints sealed with acoustical sealant and foil tape. Screw heads sealed with foil tape.</i>				
TOP/BOTTOM TRACK	1-1/4 by 96	3-5/8	ClarkDietrich ProTRAK® 20 (18 mil), Steel	2 pieces	0.39 lbs/linear ft



Total Quality. Assured.

130 Derry Court
York, Pennsylvania 17406

Telephone: 717-764-7700
Facsimile: 717-764-4129
www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

TOTAL WEIGHT (lbs)	AVERAGE WEIGHT (lbs/ft ²)
350.75	5.48

Photographs are included in Section 11.

The client did not supply a report drawing of the test specimen.

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

SECTION 10

TEST RESULTS

L3173.01C2 DATA

SPECIMEN AREA	5.95 m ²	RECEIVE TEMP.	20.7 °C	SOURCE TEMP	22.0 °C
TECHNICIAN	Zachary Gol	RECEIVE HUMIDITY	51%	SOURCE HUMIDITY	49%

FREQ (Hz)	BACKGROUND SPL (dB)	ABSORPTION (m ²)	SOURCE SPL (dB)	RECEIVE SPL (dB)	SPECIMEN TL (dB)	95% CONFIDENCE LIMIT	NUMBER OF DEFICIENCIES
80	35.6	6.3	106	87	20	1.97	-
100	37.7	5.4	108	84	24	2.22	-
125	33.2	5.7	107	78	29	1.38	8
160	40.4	5.3	111	74	37	1.01	3
200	39.3	5.3	111	68	43	0.63	0
250	30.5	5.5	107	61	46	0.65	0
315	23.7	5.8	109	59	50	0.44	0
400	20.9	6.1	110	58	52	0.86	0
500	17.4	6.2	109	54	55	0.32	0
630	18.8	6.0	107	52	55	0.28	0
800	14.6	6.2	107	50	57	0.22	0
1000	10.0	6.4	108	45	63	0.40	0
1250	8.8	6.9	107	41	65	0.24	0
1600	8.1	7.3	105	37	68	0.27	0
2000	7.5	8.0	106	42	62	0.15	0
2500	7.2	8.9	106	42	63	0.29	0
3150	7.4	10.3	104	36	66	0.23	0
4000	8.2	13.0	103	30	69	0.19	0
5000	9.3	16.4	103	26	72	0.34	-
STC RATING	53		<i>(Sound Transmission Class)</i>				
DEFICIENCIES	11		<i>(Sum of Deficiencies)</i>				
OITC RATING	36		<i>(Outdoor-Indoor Transmission Class)</i>				


- Notes:**
- 1) Receive Room levels less than 5 dB above the Background levels are red.
 - 2) Specimen TL levels listed in red indicate the lower limit of the transmission loss.
 - 3) Specimen TL levels listed in green indicate that there has been a filler wall correction applied

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

L3173.01C2 GRAPH

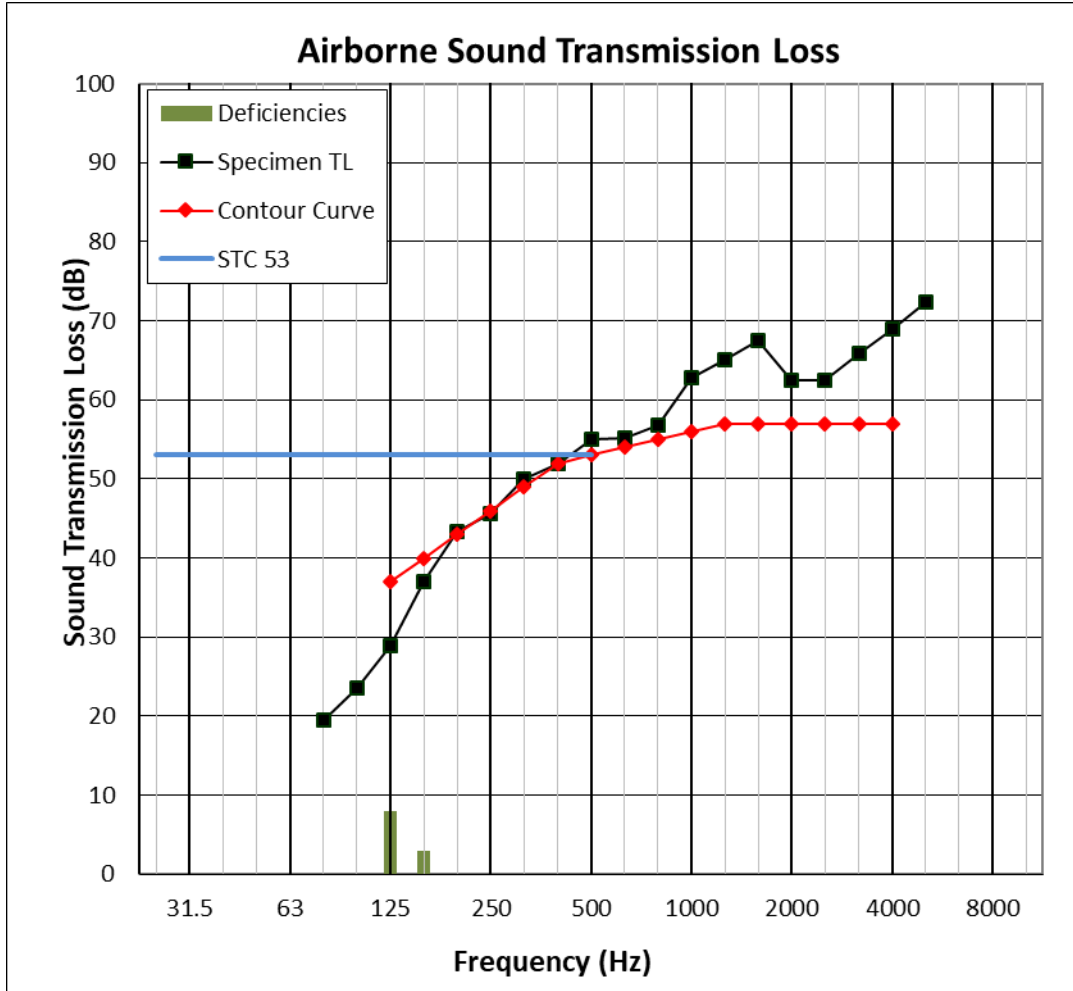

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

SECTION 11

PHOTOGRAPHS



Photo No. 1
Receive Room View of Installed Specimen



Photo No. 2
Source Room View of Installed Specimen



Total Quality. Assured.

130 Derry Court
York, Pennsylvania 17406

Telephone: 717-764-7700
Facsimile: 717-764-4129
www.intertek.com/building

TEST REPORT FOR CLARKDIETRICH BUILDING SYSTEMS, LLC

Report No.: L3173.04-113-11-R0

Date: 01/05/21

SECTION 12

REVISION LOG

REVISION #	DATE	PAGES	REVISION
0	01/05/21	N/A	Original Report Issue